Q

Search

Home / Vehicle Safety Check / 2021 AUDI RS6

2021 AUDI RS6

B Subscribe to alerts for a 2021 AUDI RS6

Submit a complaint about a 2021 AUDI RS6

Recalls Complaints Investigations Manufacturer Communications

These **recalls** apply to the make, model, and year of your car – and should be fixed as soon as possible.

7 Recalls for 2021 AUDI RS6

| Show 10 | entries | Search: |
|----------------|---|---|
| Recall Date | Component | Summary |
| 3/13/2022 | ELECTRICAL SYSTEM:INSTRUMENT PANEL:FUEL GAUGE:FUEL LEVEL FLOAT/SENSOR/SENDING UNIT | Volkswagen Group of America, Inc. (Audi) is recalling certain 2021 Audi RS6 Avant, RS7, 2020-2021 A6 Allroad, S6 Sedan, S7, 2019-2021 A6 Sedan, and A7 vehicles. The fuel level sender may stick, causing an inaccurate fuel level reading to be displayed on the instrument cluster. |
| | | Remedy: Dealers will install a new sensor in the tank, free of charge. Owner notification letters are expected to be mailed May 13, 2022. Owners may contact Audi customer service at 1- 800-253-2834. Audi's number for this recall is 20DN. |
| 1/25/2022 | SUSPENSION:REAR:AXLE:NON- POWERED AXLE ASSEMBLY TIRES | Volkswagen Group of America, Inc. (Audi) is recalling certain 2019-2021 Audi A5 Sportback, RS5 Coupe, RS5 Sportback, S5 Sportback, 2020-2021 A4 Allroad, A4 Sedan, A5 Cabriolet, A5 Coupe, A6 Allroad, A6 Sedan, A7, A8, Q5, S4 Sedan, S5 Coupe, S5 Cabriolet, |

S6 Sedan, S7, S8, SQ5, 2021 Q5 Sportback, Q7, Q8, RS6 Avant, RS7, RSQ8, SQ5 Sportback, SQ7, and SQ8 vehicles. The rear axle alignment may not have been inspected after the repairs for Recall 21V-295 (42L1) were performed.

Remedy:

Dealers will inspect the rear axle, adjust the alignment as necessary, and replace any prematurely or unevenly worn tires, free of charge. Owner notification letters are expected to be mailed March 25, 2022. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 42L5.

| Recall Date | Component | Summary |
|----------------|--|--|
| 8/4/2021 | SEAT BELTS SEAT BELTS:REAR/OTHER:RETRACTOR | Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 Volkswagen ID4, Audi A4 Allroad, A4 Sedan, A5 Cabriolet, A5 Coupe, A5 Sportback, A6 Allroad, A6 Sedan, A7, A8, E-Tron Quattro, E-Tron Sportback Quattro, Q3, Q5, Q5 Sportback, Q7, Q8, RS5 Sportback, RS5 Coupe, RS6 Avant, RS7, RSQ8, S4 Sedan, S5 Cabriolet, S5 Coupe, S5 Sportback, S6 Sedan, S7, S8, SQ5, SQ5 Sportback, SQ7, SQ8, and 2021-2022 S3 Sedan vehicles. The rear seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection." |
| | | Remedy: Dealers will inspect, and replace as necessary, the middle-rear seat belt assemblies, free of charge. Owner notification letters are expected to be mailed October 1, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298 and Audi customer service at 1-800-253-2834. Volkswagen's numbers for this recall are 69CR (VW) and 69CS (Audi). |
| 5/11/2021 | ENGINE | Volkswagen Group of America, Inc. (Audi) is recalling certain 2021 Audi SQ7, RSQ8, RS7, RS6 AVANT, and SQ8 vehicles. Cracks may develop on the surface of the engine cylinder bore. |
| | | Remedy: Dealers will replace the engine, free of charge. Owner notification letters are expected to be mailed July 9, 2021. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 10G9. |
| 4/25/2021 | SUSPENSION:REAR:AXLE:NON- POWERED AXLE ASSEMBLY | Volkswagen Group of America, Inc. (Audi) is recalling certain 2021 Q7, Q8, Q5 Sportback, SQ5 Sportback, RS6 Avant, RS7, RS Q8, 2020-2021 Audi S6 sedan, Q5, A8, S8, A7, A6 Allroad, A5 Cabriolet, A4 sedan, A4 Allroad, SQ5, S7, A6 sedan, S5 coupe, S4 sedan, S5 Cabriolet, A5 coupe, 2019-2021 RS5 coupe, A5 Sportback, S5 Sportback, RS5 Sportback vehicles. The lock nut on the trailing arm of the rear axle may break due to stress corrosion. |
| | | Remedy: Dealers will replace the lock nuts and, if necessary, the associated bolts, free of charge. Owner notification letters are expected to be mailed June 25, 2021. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 42L1. |
| 3/9/2021 | AIR BAGS | Volkswagen Group of America, Inc. (Audi) is recalling certain 2021 Audi RS6 Avant, RS7, 2020-2021 A6 Allroad, S6 Sedan, S7, 2019-2021 A6 Sedan, and A7 vehicles. The score line |

on the passenger air bag may not have been manufactured correctly.

Remedy:

Audi will notify owners, and dealers will inspect the passenger air bag score line, and

repair it as necessary, free of charge. The recall is expected to begin May 7, 2021.

Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this

recall is 70i2.

| Recall Date | Component | Summary |
|-----------------------------|--|---|
| 12/1/2020 | AIR BAGS:SENSOR:SIDE IMPACT ELECTRICAL SYSTEM | Volkswagen Group of America, Inc. (Audi) is recalling certain 2021 Audi A6 Allroad, Q7, RS6 and RS7 vehicles. The electrical connector can detach from the door crash sensor in either of the front doors. |
| | | Remedy: Audi will notify owners, and dealers will inspect, and as necessary, replace the crash sensors in both front doors, free of charge. The recall began December 23, 2020. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 69BM. |
| Showing 1 to 7 of 7 entries | | Previous 1 <u>Next</u> |
| | | 2021 AUDI RS6 |
| | YF | search for another vehicle |

| YEAR | ~ |
|-------|---|
| ΜΑΚΕ | ~ |
| MODEL | ~ |



Address

Suite 331 Washington, DC 20015-2113

Join our Email List

Email (Required)

email@address.com

Name

Subscribe

Built by Experience Solutions